

OYSTER COVE (2AK4) 11 NW N59°28.20' W151°30.75' UTC-9(-8DT)

PVT 45 12(GVL) 12-30


SEWARD
L-1A, 2J, 3D, 4F

AIRPORT REMARKS: Unattended. Rwy 12, light on shore breeze creates 4 to 5 knot tailwind most summer days.

WEATHER DATA SOURCES—(WX CAM).

COMMUNICATIONS: (TIE-IN FSS HOMER HOM 1500-0630Z; OT CTC KENAI ENA)

RADIO/NAV/WEATHER REMARKS—Local call to Homer FSS dial 235-8588. For a toll free call to Kenai FSS dial 1-866-864-1737.

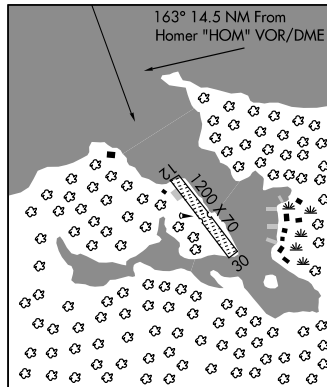

HONEYBEE LAKE AERO PARK (See WILLOW)

HOONAH

§ **HOONAH** (HNH) (PAOH) 1 SE N58°05.77' W135°24.58' UTC-9(-8 DT)

JUNEAU

P 19 BL 4, 10 ① H30(ASP) 06-24

AIRPORT REMARKS—Unattended. Arpt condition not monitored, arpt maintenance on irregular basis, recommend dalgt ops and visual inspection prior to using. High terrain all quadrants. Uncontrolled vehicular tfc, pedestrians, birds, bears, and deer. invof arpt. Parachute jumping onto arpt rwy, twy and acft parking apron prohibited. Rwy 06 rgt tfc. CLOSED to air carrier ops over 30 passenger seats. Arpt CLOSED to acft over 12,500 lbs GTW, except PPR from Arpt Safety and Security, DOT and Public Facilities, P.O. Box 112506, Juneau, AK 99811-2506, call 907-465-1786. Be alert: Zip-line 6 cables 2 NM northwest of arpt, from 200'-1600' uncharted and unlgtd. Twy A centerline incorrect spacing gaps to rwy side hold short line. See General Notices—ENROUTE CTAF FREQS. ACTIVATE MRL Rwy 06-24 and REIL Rwy 06 and Rwy 24—CTAF. NOTE: See Special Notices—Hoonah, Alaska Icy Strait "Zip Line". ①Rwy 06, Rwy 24.

WEATHER DATA SOURCES —(ASOS 132.05 907-945-3687) (WX CAM).

COMMUNICATIONS—(CTAF 122.7) (TIE-IN FSS JUNEAU JNU-NOTAM HNH)

RCO —122.35 (JUNEAU FSS)

RADIO/NAV/WEATHER REMARKS —For a toll free call to Juneau FSS dial 1-800-WX-BRIEF.

